



1234 Main Street Katy TX 77494

Sent: Thu, 29 Dec 2022 08:14

PREPARED BY:

Pricing Team

QUESTIONS? CLICK HERE TO GET HELP

Summary





TOTAL ESTIMATE:

\$6,555



# Item	Pg	Action	Projected
HANDYMAN. 1 3: Siding Nails. Maintenance Item. Improperly seal or installed nails in siding. Multiple locations.	14	Secure and seal noted fasteners to prevent water intrusion.	\$233
2 1: Door Adjustment. Maintenance Item. Bedroom 3 Second Floor East. Door close by itself. Door and frame not aligned. Recommend handyman DIY to align.	15	Adjust noted doors to operate correctly.	\$206
		Sub-Total (Handyman).	\$439
ELECTRICIAN. 3 1: Inadequate Number of Receptacles. Garage, South. Flexible Extension Cord used as permanent installation indicate insufficient number of receptacles in the home. This can cause a short circuit. Recommend licensed electrician add additional exterior receptacles.	19	Install outlet where noted.	\$551
4 3: Cover Plate Loose or Missing. Maintenance Item. Recommendation: Contact a handyman or DIY project.	33	Repair or install outlet, switch covers and secure throughout.	\$148
		Sub-Total (Electrician).	\$699
 PLUMBER. 5 1: Faucet Connector Maintenance Item Half Bathroom Hot Water Faucet Connector with signs of corrosion. Recommendation: Contact a handyman or DIY project. 		,	\$270
6 2: Improper Water Pop-Up Stopper Installation. Maintenance Item. Master Bathroom. Water Pop-Up Stopper installed improperly. Recommend a qualified handyman or plumber evaluate and repair.	33	Install or repair drain stoppers in areas as needed.	\$141
		Sub-Total (Plumber).	\$411
 HVAC. 7 1: Needs Servicing/Cleaning. Maintenance Item. Media Filter and Fresh Air Filter should be replaced according to manufacturers recommendations. Furnace should be cleaned and serviced annually. Recommend a qualified HVAC contractor clean, service and certify furnace. 	24	Adjust clean and inspect units for correct operation.	\$325
8 1: Air Flow Restricted. South. Mineral deposits in condenser coil and fins. Air flow to the air conditioner condenser might be restricted. This may result in inefficient operation. Recommend chemical cleaning of the unit. Consult with HVAC Professional.	. 26	Service and clean as needed.	\$221
9 1: Ducts Not Properly Sealed. Attic 1 Roof. Air supply ducts were not properly sealed. Recommend a qualified HVAC contractor seal supply and return ducts for maximum efficiency.	29	Service call to clean and seal chase.	\$208
		Sub-Total (HVAC).	\$754

ROOFING CONTRACTOR.



# Item	Pg	Action	Projected
10 2: Asphalt Shingle Cracks. South. Some Asphalt Shingle Cracks. Recommended roofing professional to evaluate	9	Price Included In Item 10. (Roof repairs needed in noted areas).	_
Recommendation: Contact a qualified roofing professional.	0		0007
11 1: Localized Granulate Loss. West. Excessive granulate loss. Localized shingle wear. Recommended roofing contractor to evaluate and repair as needed.	9	Roof repairs needed in noted areas.	\$887
and repair as needed.			
		Sub-Total (Roofing Contractor).	\$887
INSULATION.			
12 1: Insufficient Insulation. Attic 2 Second Floor Southwest. Insulation depth was inadequate. Recommend a qualified attic insulation	12	Install attic insulation to R38 value.	\$1,531
contractor install additional insulation.			
13 2: Potential Insulation Deficiency. Recommend further evaluation by insulation contractor for evaluation and repair as needed.	14	Price Included In Item 12. (Install attic insulation to R38 value).	
		Sub-Total (Insulation).	\$1,531
			41,00 1
GARAGE DOOR.			
14 1: Pressure Auto Reverse Sensor Not Working. Safety Hazard. Garage. The pressure auto reverse sensor was not responding at	41	Service call to adjust garage door and service auto reverse to	\$207
time of inspection. This is a safety hazard to children and pets. Recommend a qualified garage door contractor evaluate and repair/replace.		improve safety.	
терап/теріасе.			
		Sub-Total (Garage Door).	\$207
APPLIANCE.	20	Coming well to recover much and adjust	04.47
15 1: Rack Corrosion. Recommendation: Contact a qualified appliance repair professional.16 1: Microwave Plate doesnt turn. Recommendation: Contact a qualified appliance repair professional.		Service call to remove rust and adjust. Repair noted items on microwave.	\$147 \$123
10 1. Millionato Filato addotti tarii. Nodotiinidiaatori. Goritadi a qualiinda appiiarioo ropaii professioriai.	10	repair noted to the off more than .	Ψ120
		Sub-Total (Appliance).	\$270
CONCRETE CONTRACTOR. 17 1: Nail Corrosion. North South. Nail Corrosion observed near in foundation and near post tension cable patch. Recommended repair	r/ 6	Beam patches at cable ends after treating with rust inhibitor to	\$501
patch.	, 0	extend life of materials.	ψ301
18 1: efflourescence. South. Efflorescence evidence at south wall. Owner commented that was due to a ac mist system. Condenser fin	ns 13	Clean with muriatic acid allow to dry and seal after grade and	\$988
and cabinet showed mineral deposits. No moisture evidence at the interior or exterior wall at the time of the inspection as evaluated		gutter corrections.	
with thermal imaging and moisture meter. Recommended further evaluation.			
		Sub-Total (Concrete Contractor).	\$1,489
		ous rotal (solititete solitiactor).	Ψ1, - 03

GUTTERS.



# Item	Pg	Action	Projected
19 1: Gutter and Downspout System. West. Recommend Gutter Contractor to evaluate and repair/replace as needed.	6 Service to i	mprove flow of water and repair as needed.	\$404
20 2: Downspout System (Gutter & Downspout System). North, South, East. Gutter Contractor to evaluate and repair as needed. An alternative recommendation is to, at least, install splash blocks to divert the water away from the foundation.	7 Install splas	sh blocks where needed.	\$170
	Sub-Total	(Gutters).	\$574
 VENT CONTRACTOR. 21 1: Lint Accumulation. Maintenance Item. Laundry. Recommend annual cleaning / swipe dryer vent duct-work. Dryer vent duct-work with excessive lint is a potential fire hazard. 	42 Service cal	I to clear lint debris and improve safety.	\$184
	Sub-Total	(Vent Contractor).	\$184

Thank you for choosing Repair Pricer

About Repair Pricer

Repair Pricer is the industry standard for converting inspection reports into accurate repair estimates during the complex home purchasing process, enabling all parties to act quickly and confidently during a critical period. Repair Pricer saves time and reduces stress for everyone when it matters most. To learn more about Repair Pricer, visit www.repairpricer.com



It is important you understand that the service provided by RepairPricer.com is purely for estimation and negotiation purposes. We do not guarantee that the prices we estimate for repairs on your report are the same that you will end up paying for that specific repair. Our pricing is based on the average cost for a similar repair in your area, and due to unknown factors or underlying issues that we are not privy to, actual repair cost may be substantially higher.